


ASSEMBLY & INSTALLATION INSTRUCTIONS

A528

Penumbra Pendant 139810

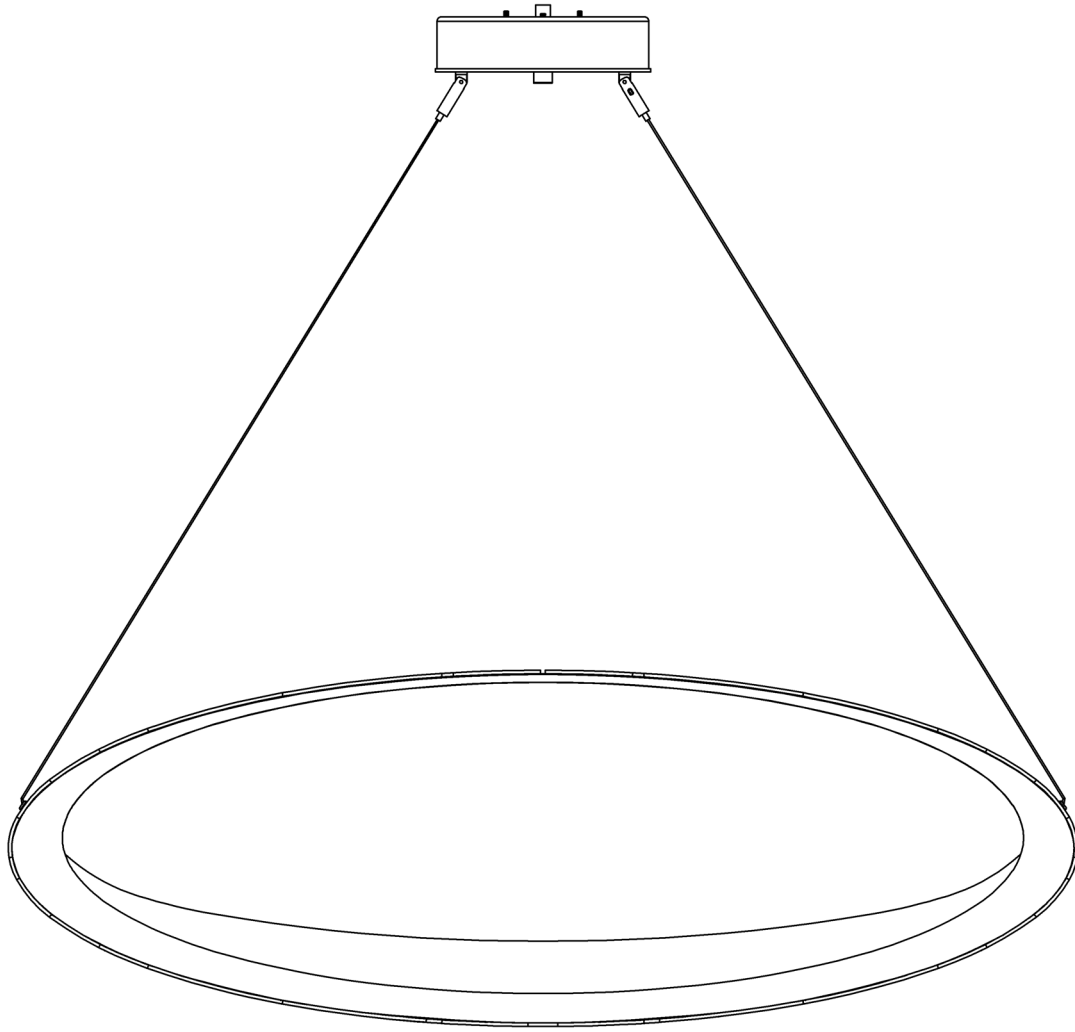

HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

40145

Component Parts

- A** **Canopy**
- B** **Canopy Cover Plate**
- C** **Cap**
- D** **Threaded Nipple**
- E** **Lock Nut**
- F** **Ground Screw**
- G** **Cupped Washer**
- H** **Fixture**
- I** **Support/Supply Cable (2)**
- J** **Gripper (2)**
- K** **Holder (4)**
- L** **Decorative Element**
- M** **Knobs (4)**



ASSEMBLY & INSTALLATION INSTRUCTIONS

A528

Penumbra Pendant 139810

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician. This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*


Caution: Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

Please Note: After installation extra hardware and accessories are possible; our kits are used on multiple products.

To Attach to Ceiling (Figure 1)

CAUTION: BE SURE POWER IS OFF AT THE MAIN BREAKER BOX PRIOR TO INSTALLATION.

1. Carefully unpack the fixture from the carton.
2. Locate canopy assembly. Remove cap (C) and canopy cover plate (B) and set aside for later use.
3. Thread the wires in the electrical box through the hole in the canopy (A) while moving the canopy into position. Using two machine screws (not provided) fasten canopy (A) to the electric box.
Note: Position the canopy so that the grippers are in line with the desired direction of your fixture.
Note: A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.
4. Lift canopy cover plate (B) up to the bottom of canopy (A) allowing the threaded nipple (D) to come through the hole in the center of the canopy cover plate (B).
5. Screw the cap (C) onto the threaded nipple (D) to hold the canopy cover plate (B) to the bottom of the canopy (A). Adjust the height of the threaded nipple (D) until the cap (C) tightens fully with the canopy cover plate (B) tight to the bottom of the canopy (A).
6. Remove cap (C) and canopy cover plate (B) from threaded nipple (D). Tighten lock nut (E) to inside of canopy (A). This will lock the height of the threaded nipple (D).
7. Attach a pigtail lead to the canopy (A) using the provided ground screw (F) and cupped washer (G) in kit bag.
8. Using suitable wire connectors (not provided) connect driver wires to supply wires (white to white and black to black). Holding canopy cover plate (B) close to canopy (A), connect all ground wires (bare copper or green to bare copper or green) together.

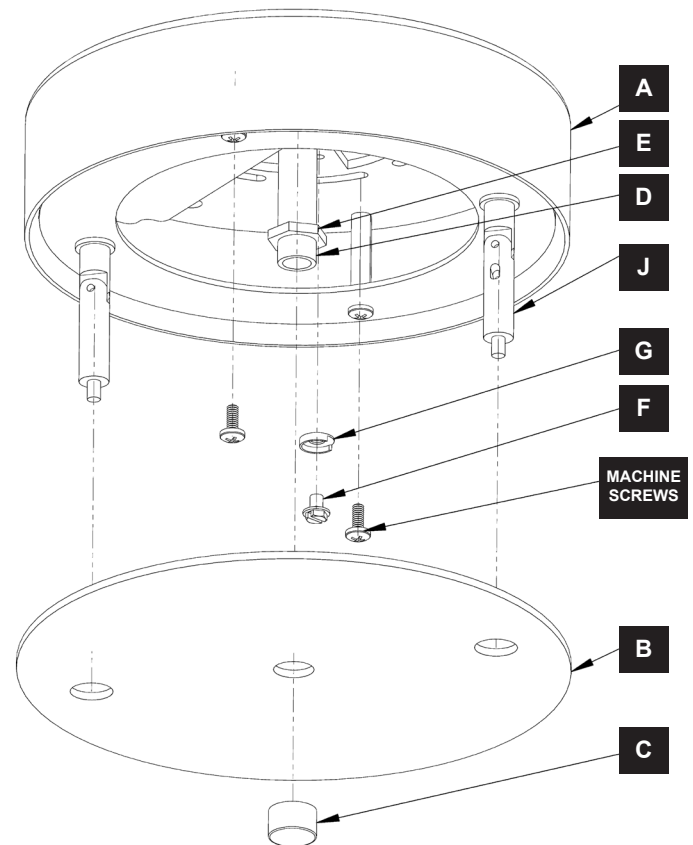

(Figure 1)

CAUTION: MAKE SURE WIRE CONNECTORS ARE TWISTED ON SECURELY, AND NO BARE WIRES ARE EXPOSED.

9. Raise canopy cover plate (B) to the bottom of canopy (A) and secure with cap (C), being sure no wires are pinched between canopy (A) and the ceiling.

HF HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

40145

Penumbra Pendant 139810


To Install Fixture (Figure 2)

1. Locate the positive (+) label on top of the fixture (H).
2. Align the positive (+) sticker on the fixture (H) with the positive (+) sticker on the gripper (J).
3. Push the support/supply cable (I) from the positive (+) side of the fixture (H) into the positive (+) gripper (J). Push the cable (I) in far enough so that the cable (I) exits the side of the gripper (J).
4. Repeat step 3 for the remaining supply/support cable (I) and gripper (J).
5. Adjust fixture (H) to desired height by pressing in the plunger on the gripper and pushing/pulling the supply/support cables (I) as necessary.
6. Once the fixture (H) is at the desired height cut the supply/support cables (I) as close to the notch in the gripper (J) as possible.

CAUTION: ONCE EXCESS CABLE IS CUT, FIXTURE CANNOT BE LOWERED.

CAUTION: BE SURE NO PIECE OF THE SUPPORT CABLE IS TOUCHING THE FIXTURE.


7. Follow instructions on the following page to complete installation.

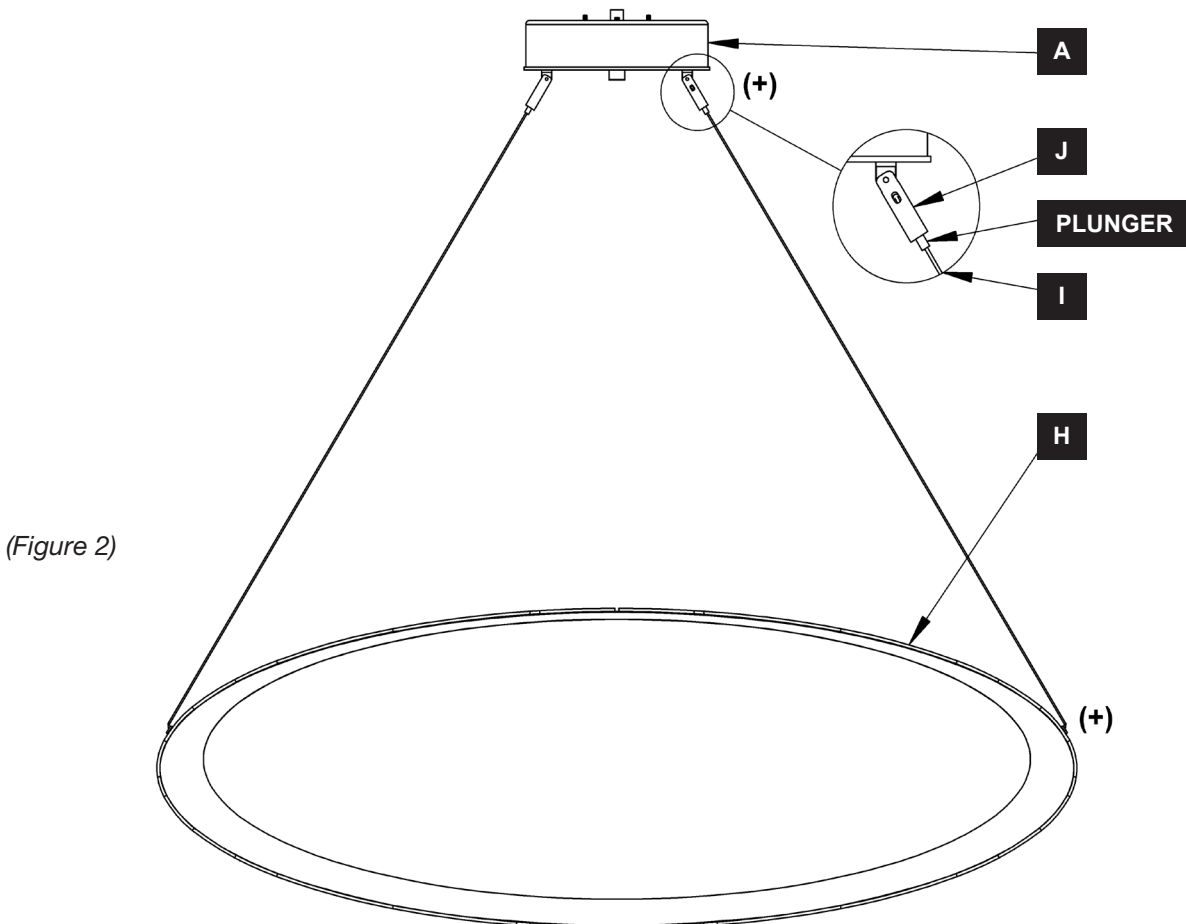

Penumbra Pendant 139810

To Complete Installation *(Figure 3)*

1. Locate decorative element (L) with knobs (M) attached.
2. Slide element (L) into fixture (H).
3. Align knobs (M) with holders (K) and lower decorative element (L) into holders (K).
4. Center decorative element (L) in fixture (H).
5. Restore electricity at main breaker.

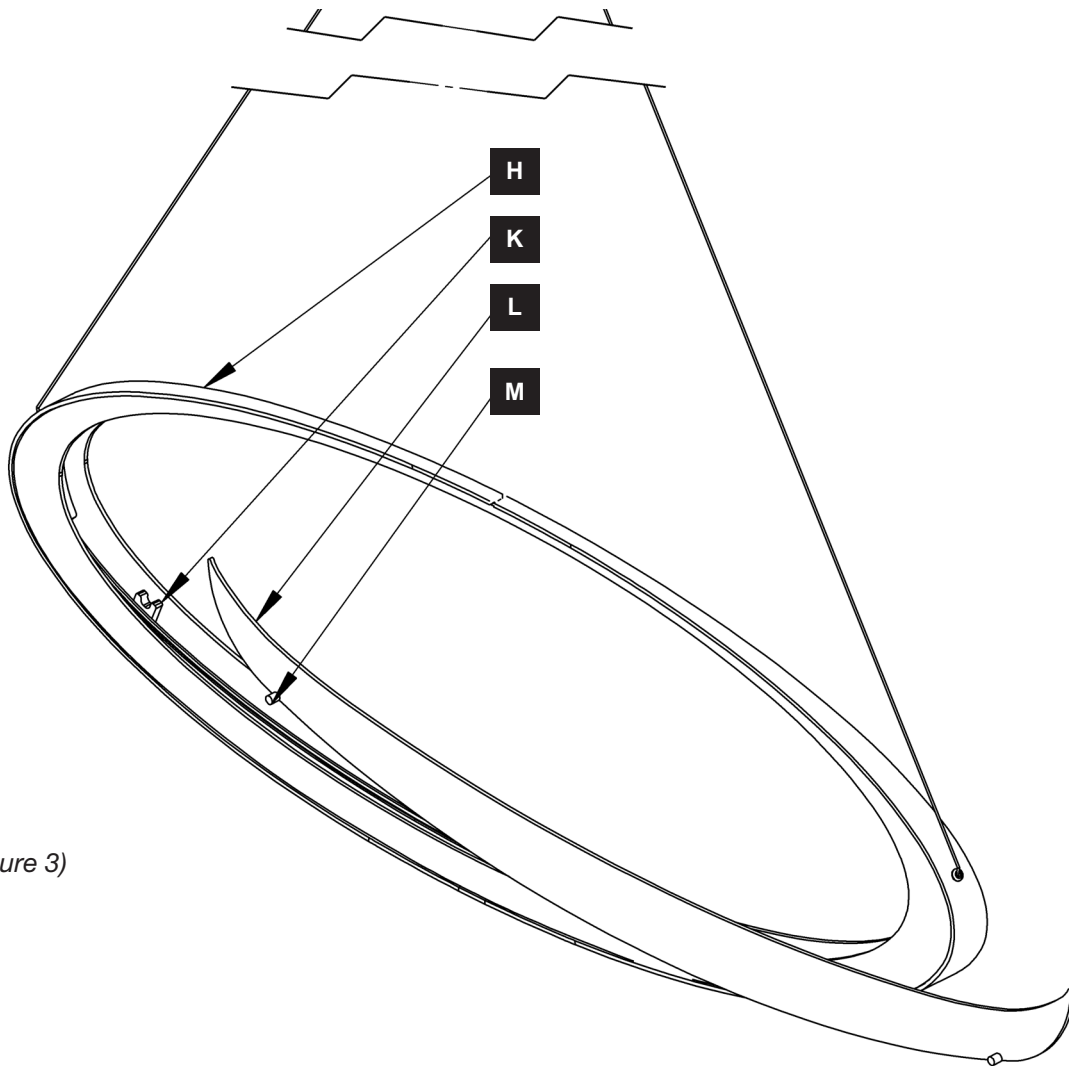

(Figure 3)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

*** Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.**